

AIRCRAFT LOG

VOR Receiver operation checked

In a
tte B V

DATE

REMARKS

N53426 HOBBS: 278.9 ACFT: TT- 2744.8 DATE: 10-20-2011

Replaced left and right fuel selector valves with serviceable like units. Replaced left and right fuel system lines. Replaced left and right wing sump drains with new. Removed left and right fuel pumps, throttle body controllers, and fuel manifolds. Reinstalled in original positions after Overhaul. See engine logs for details. Replaced battery switch with new. Replaced front and rear fuel strainer assemblies with new. Replaced rear engine left hand muffler clamp. C/W AD84-26-02, installed new paper filters. C/W AD2011-10-09 inspection of pilot and co-pilots Seats, rails, locks, and rollers. AD2000-06-01 found not to apply. AD2004-19-01 found not to apply by model. C/W AD71-17-08 rear engine idle speed. Aircraft ground ran systems operational check ok this date.

This aircraft has been inspected and found safe for the intended flight I.A.W. special flight permit dated October 20, 2011.

Martin Bayliss
Martin Bayliss
AP435967067